...ERTY OF JBL INCORPORATED. THEY ...REPRODUCED, COPIED OR USED ...PARATUS WITHOUT WRITTEN

...TION	MFG.		REMARKS
M. NTWK	N4406		
...BLY	N4406		FIELD REPAIR

REVISIONS					
CHG	LTR	DESCRIPTION	DR	CHK	DATE	APPR
[illegible]	A	REL FOR PROD [illegible]	[illegible]	[illegible]	1-4-86	[illegible]
[illegible]	B	[illegible] 35353 AND NOTE 5	[illegible]	[illegible]	[illegible]	[illegible]
7866	C	DCL 35353 ON -0101	S.H.	[illegible]	9/24/86	[illegible]

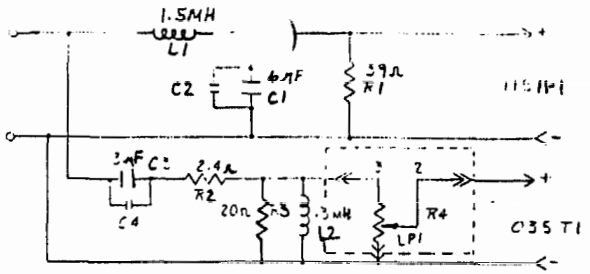

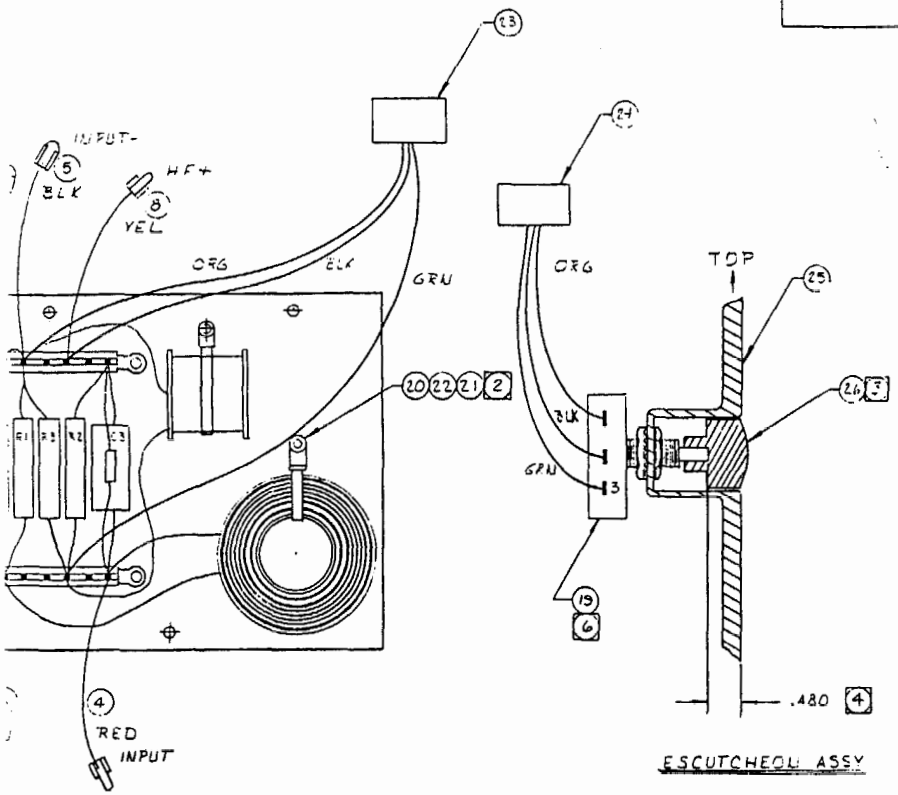

N4406

		ITEM	PART NO.	DESCRIPTION	QTY	REMARKS
		29				
		28				
—	3	27	35353S	CABLE TIE		
1	1	26	66934	KNOB, MONITOR		
1	1	25	66932	ESCUTCHEON		
1	1	24	66970	WIRE/CON ASSY 3 CKT M		
—	1	23	66969	WIRE/CON ASSY 3 CKT F		
—	2	22	37023S	CABLE TIE		
—	2	21	10251	WASHER FLAT		
—	6	20	42110	RIVET		
1	1	19	53450	L PAD		LP1
	1	18	60791-0390	RESISTOR WW 39 OHM 10W		R1
	1	17	60791-0200	RESISTOR WW 20 OHM 10W		R3
	1	16	60791-0224	RESISTOR 2.4 OHMS		R2
	1	15	60625-01	AIRCORE INDUCTOR .5MH		L2
	1	14	66968-01RS	INDUCTOR 1.5MH		L1
	1	13	60990-06RD	CAPACITOR 6MF 200V MYLAR		C1
	1	12	60990-03RC	CAPACITOR 3MF 200V MYLAR		C3
	2	11	61098	CAPACITOR .01 MF 200V POLY		C2,C4
	.005	10	24474S	SOLDER ROSIN		
	1	9	57173-31	WIRE/CONNECTOR ASSY YEL, BLK		
	1	8	57173-30	WIRE/CONNECTOR ASSY YEL		
	1	7	57173-29	WIRE/CONNECTOR ASSY GRN, BLK		
	1	6	57173-28	WIRE/CONNECTOR ASSY GRN		
	1	5	57173-46	WIRE/CONNECTOR ASSY BLK		
	1	4	57173-45	WIRE/CONNECTOR ASSY RED		
	1	3	A5884	JETMELT 3M		
	2	2	10239	TERMINAL STRIP 6T		
	1	1	66967	MTG. BOARD		
-0101	-01					

BILL OF MATERIAL

LS TOWARD TOP.

IE, ITEM 27 TO EACH PAIR OF LEADS
6" FROM NETWORK BOARD.
CE OF ESCUTCHEON TO TOP OF L PAD SHAFT.

INDICATE "+1" WHEN SHAFT ON L-PAD IS ROTATED FULLY CW.

S AS SHOWN. MOUNT WASHER ATOP CABLE TIE HOLE FOR RIVET
TORS TO MOUNTING BOARD WITH ITEM 3.

1 THRU 14 AND 16 THRU 18 TO BOARD WITH ITEM 3.

IFIED)

TOLERANCES (UNLESS OTHERWISE SPECIFIED)

JBL Incorporated
A Harman International Company
Northridge California 91329 USA

MFD ITEM NTWK

SIZE D | DRAWING NO. 66930-XX | REV C

SCALE 1/1 | SHEET 1 OF 1

7 6 5 4 3 2 1