


FM TUNING UNIT

PART NO. 471538

PRINTED CIRCUIT BOARD

BUILT-IN FM ANTENNA


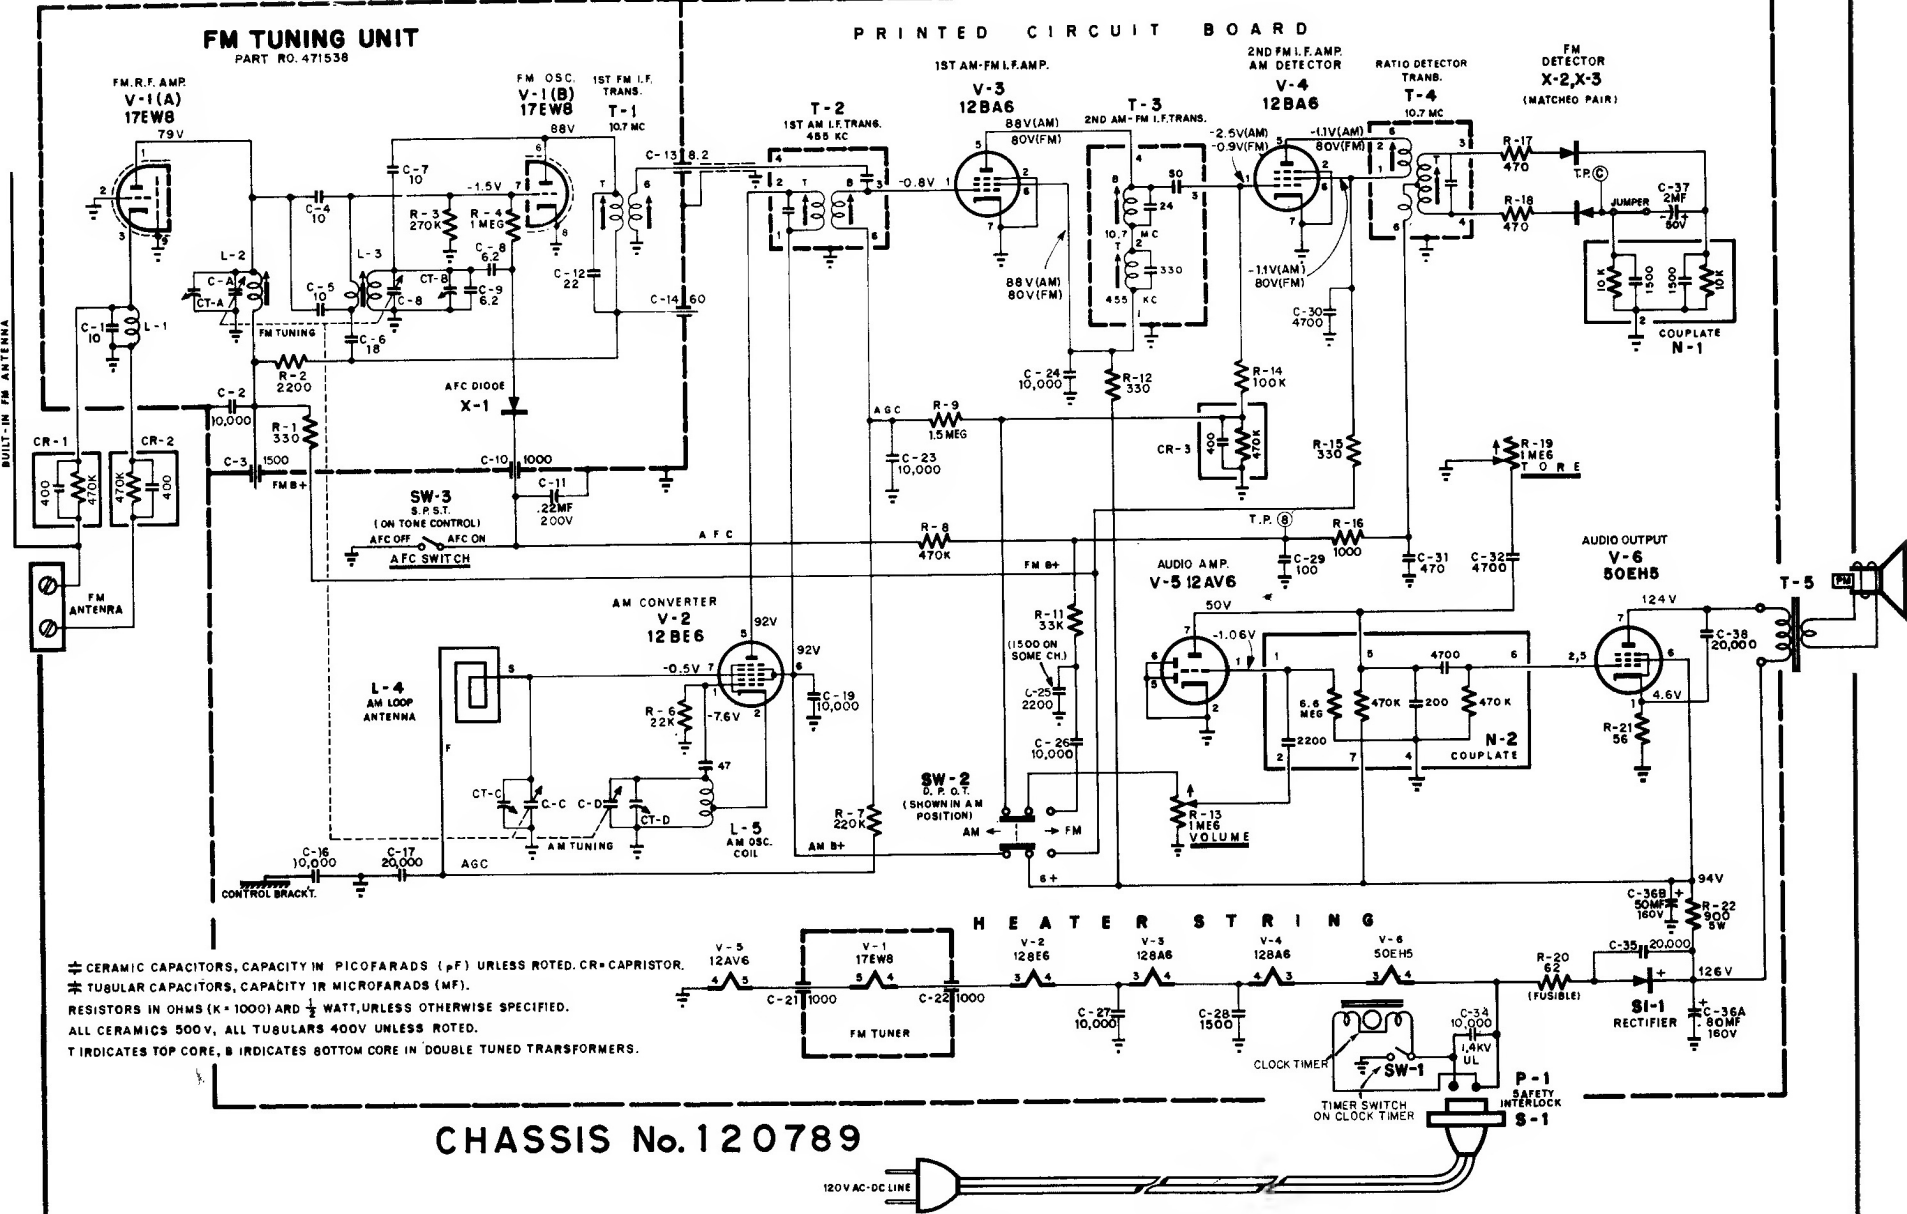


* CERAMIC CAPACITORS, CAPACITY IN PICO FARADS (PF) UNLESS NOTED. CR=CAPRISTOR.
 * TUBULAR CAPACITORS, CAPACITY IN MICRO FARADS (MF).
 RESISTORS IN OHMS (K=1000) AND 1/2 WATT, UNLESS OTHERWISE SPECIFIED.
 ALL CERAMICS 500V, ALL TUBULARS 400V UNLESS NOTED.
 T INDICATES TOP CORE, B INDICATES BOTTOM CORE IN DOUBLE TUNED TRANSFORMERS.

CHASSIS No. 120789

EMERSON Chassis 120789, Models 31L07, 31L08,


EMERSON Chassis 120789, Models 31L07, 31L08

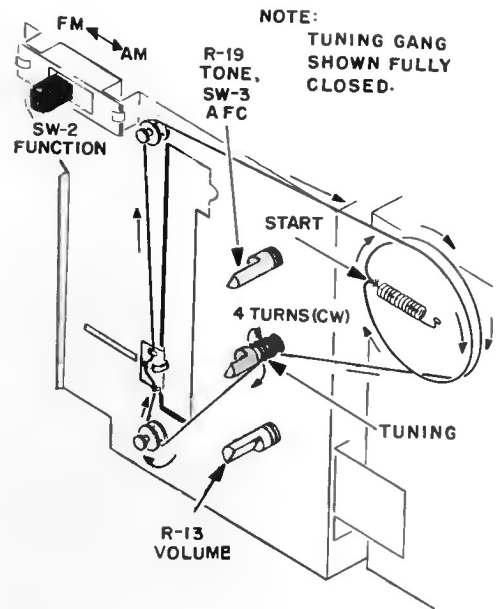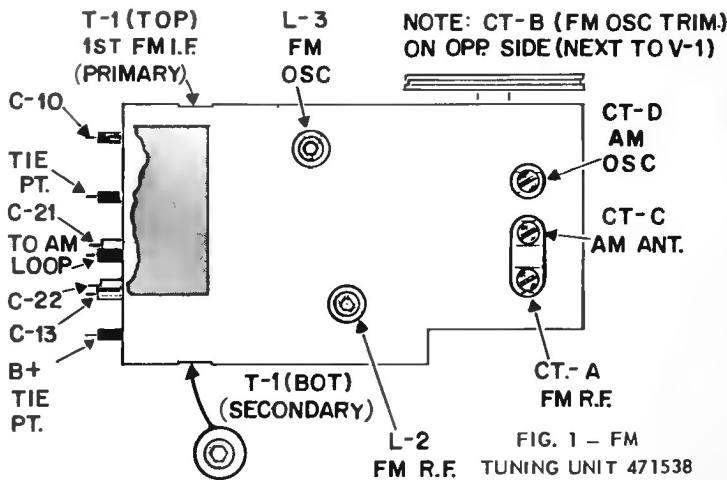


REPLACEMENT INFORMATION FM TUNING UNIT 471538

When removing the FM tuning unit for exchange or replacement, be sure to retain the dial string pulley, associated mounting parts and rubber grommets. New units are supplied by the factory complete with metal cover and vacuum tube, but less the items noted above.

DIAL STRINGING

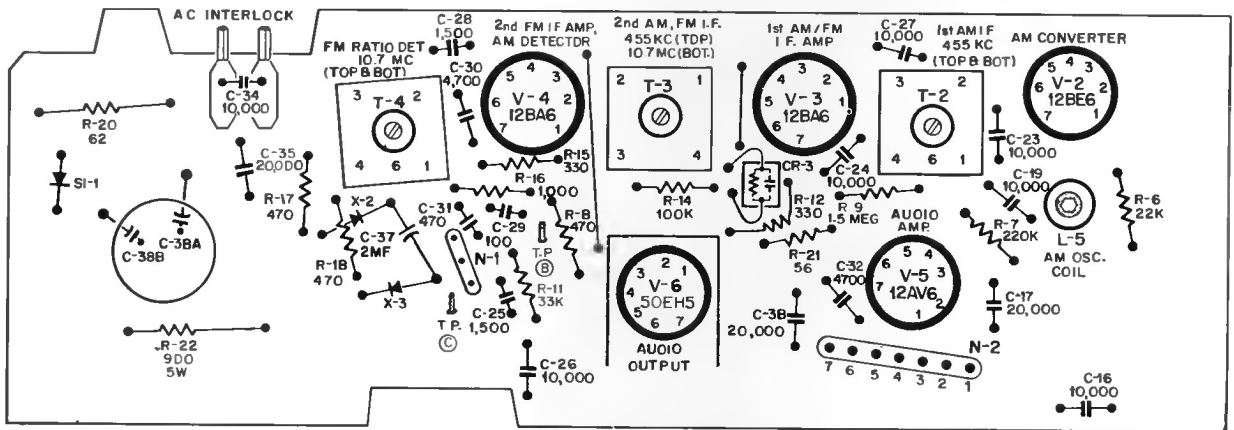

TUBE LOCATIONS AND ALIGNMENT POINTS

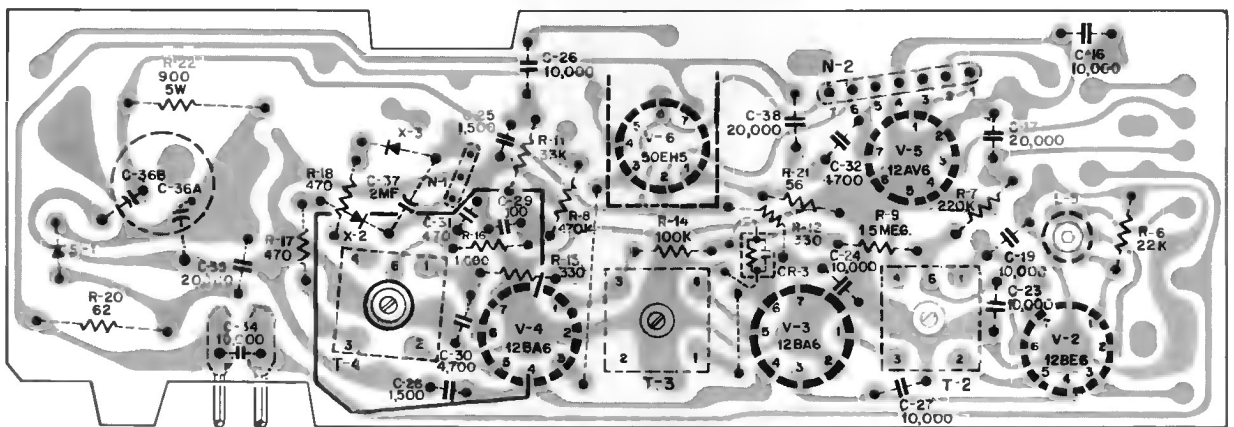

ETCHED CIRCUIT CHASSIS (BOTTOM VIEW)