GENERAL ELECTRIC

Model P780A

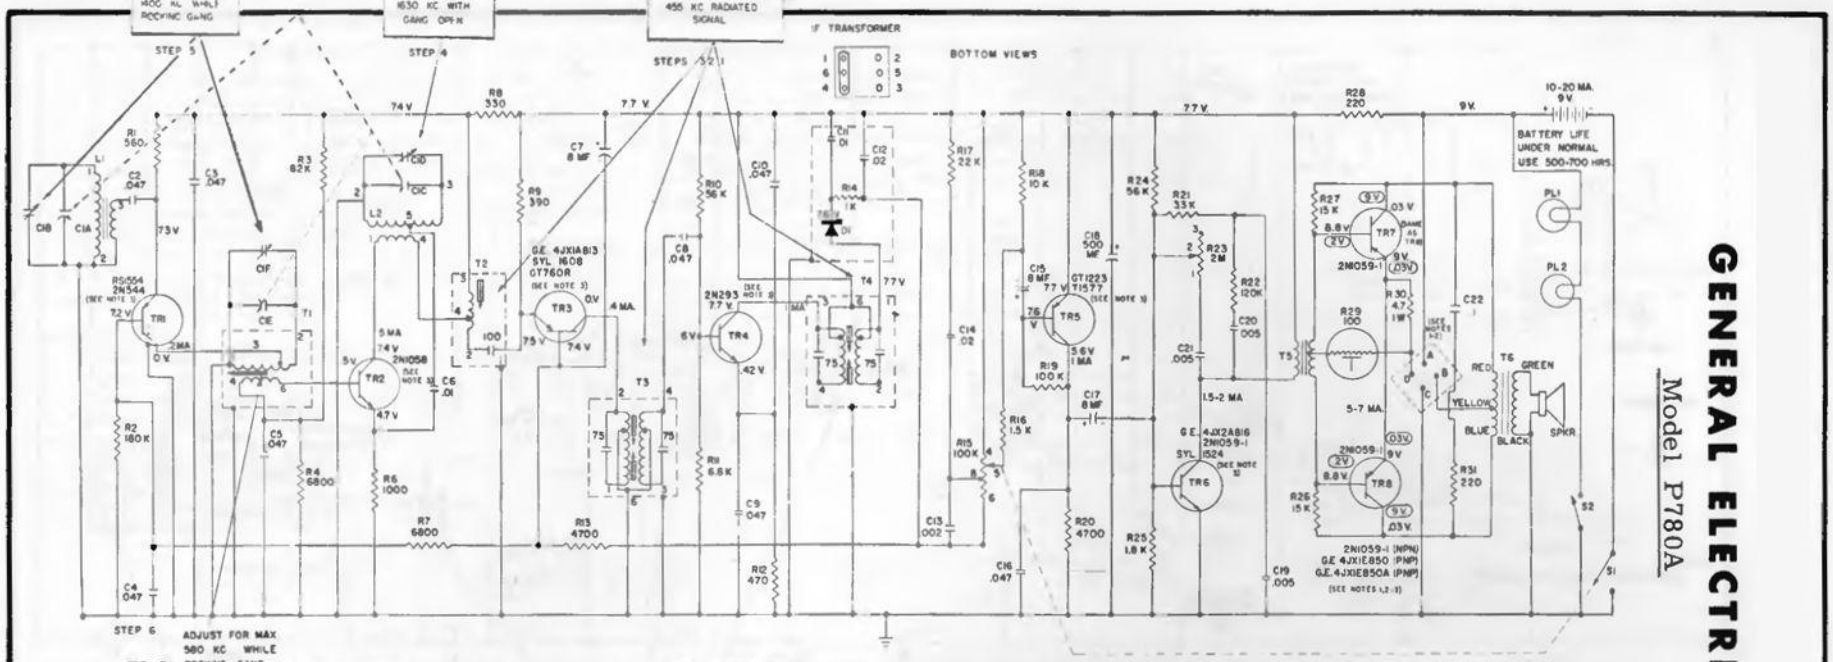

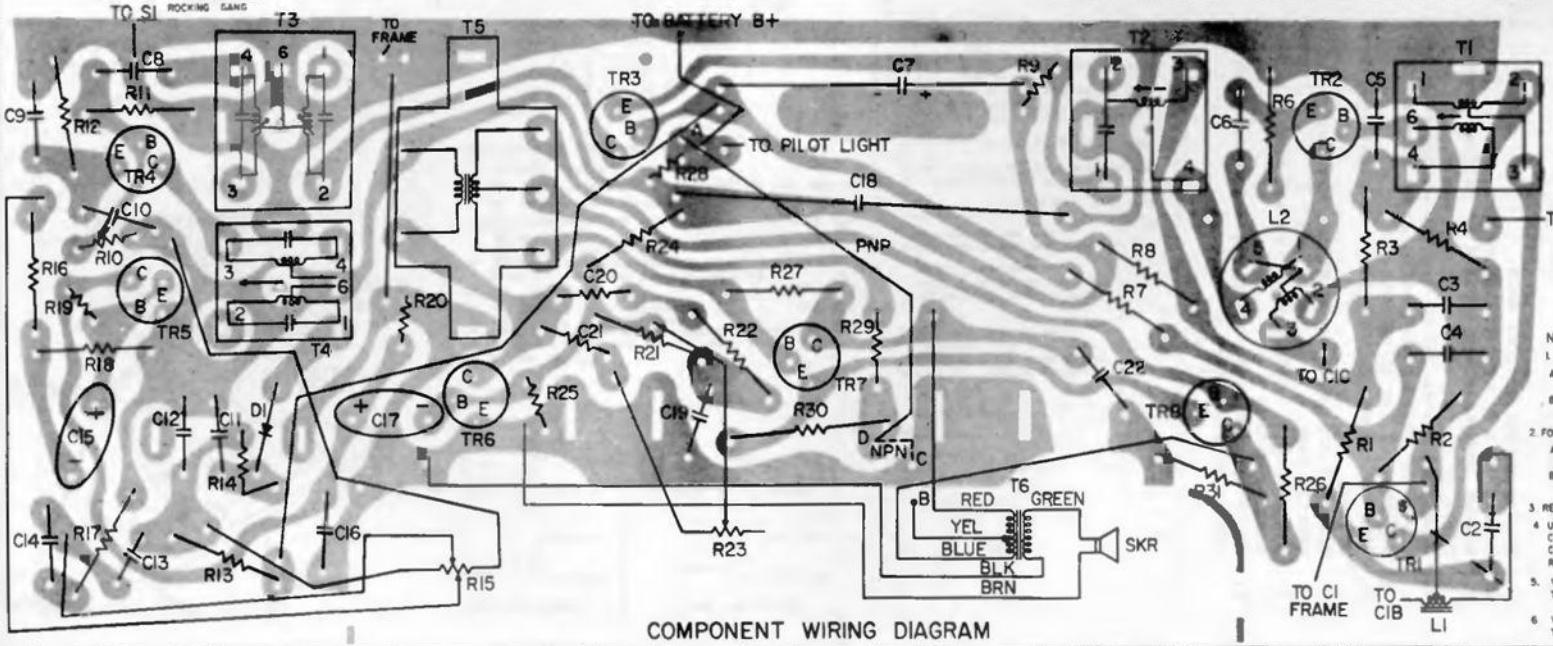

COMPONENT WIRING DIAGRAM

NOTES

1. FOR NPN TR7 AND TR8
   A. CONNECT YELLOW LEAD "B" FROM T6 TO POINT "A" (SEE COMPONENT WIRING DIAGRAM)
   B. CONNECT A JUMPER WIRE BETWEEN POINTS "C" AND "D" (SEE COMPONENT WIRING DIAGRAM)
2. FOR PNP TR7 AND TR8
   A. CONNECT YELLOW LEAD "B" FROM T6 TO POINT "C" (SEE COMPONENT WIRING DIAGRAM)
   B. CONNECT A JUMPER WIRE BETWEEN POINTS "A" AND "D" (SEE COMPONENT WIRING DIAGRAM)
3. REPLACE WITH TRANSISTOR TYPES SHOWN.
4. UNLESS OTHERWISE NOTED
   CAPACITORS MORE THAN 1 MMF
   CAPACITORS LESS THAN 1 MF
   RESISTORS ARE 1/2 WATT (K=1000)
5. VOLTAGES ARE POSITIVE WITH RESPECT TO GROUND UNDER NO SIGNAL CONDITIONS.
6. VOLTAGES SHOWN IN ▭ ARE WITH TR7 AND TR8 NPN