
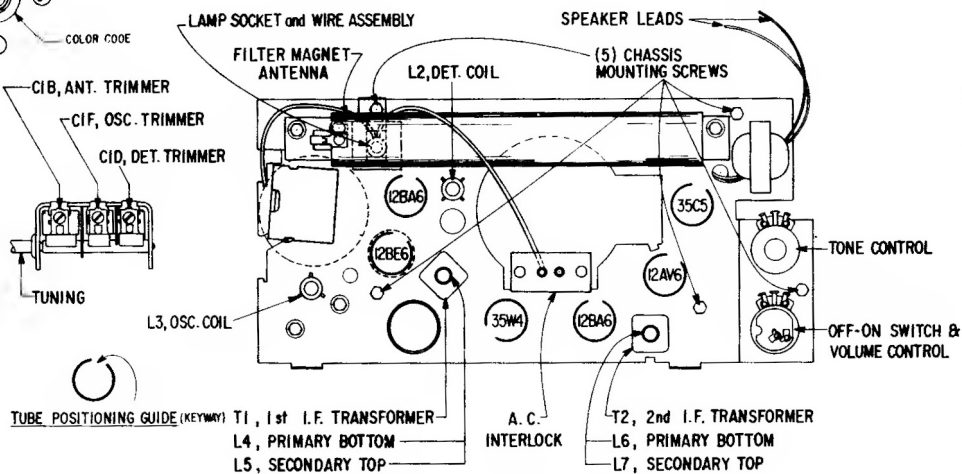
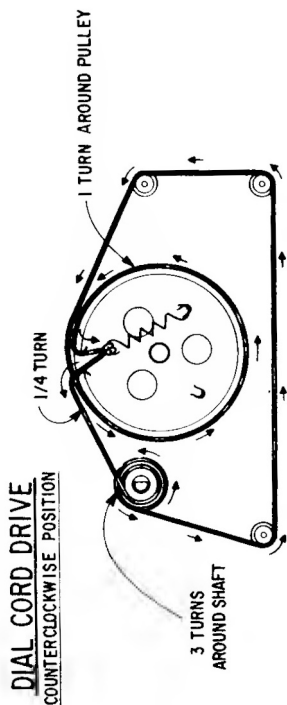
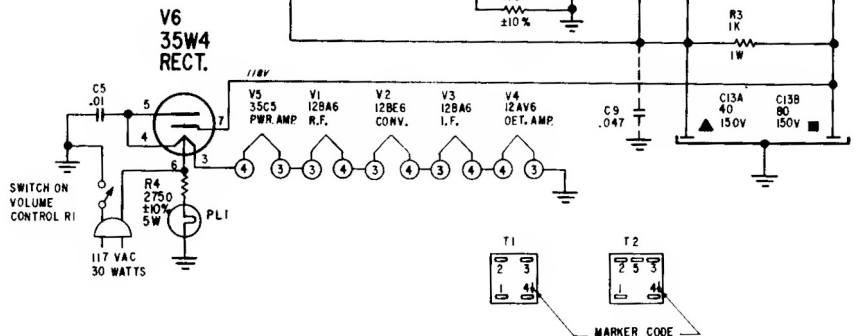
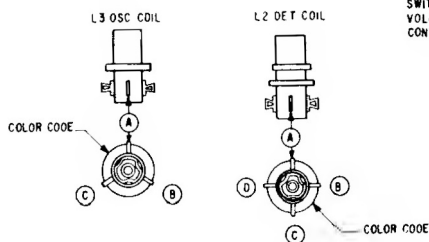


ZENITH RADIO CORPORATION MODELS N615C, L & W CHASSIS 6N05

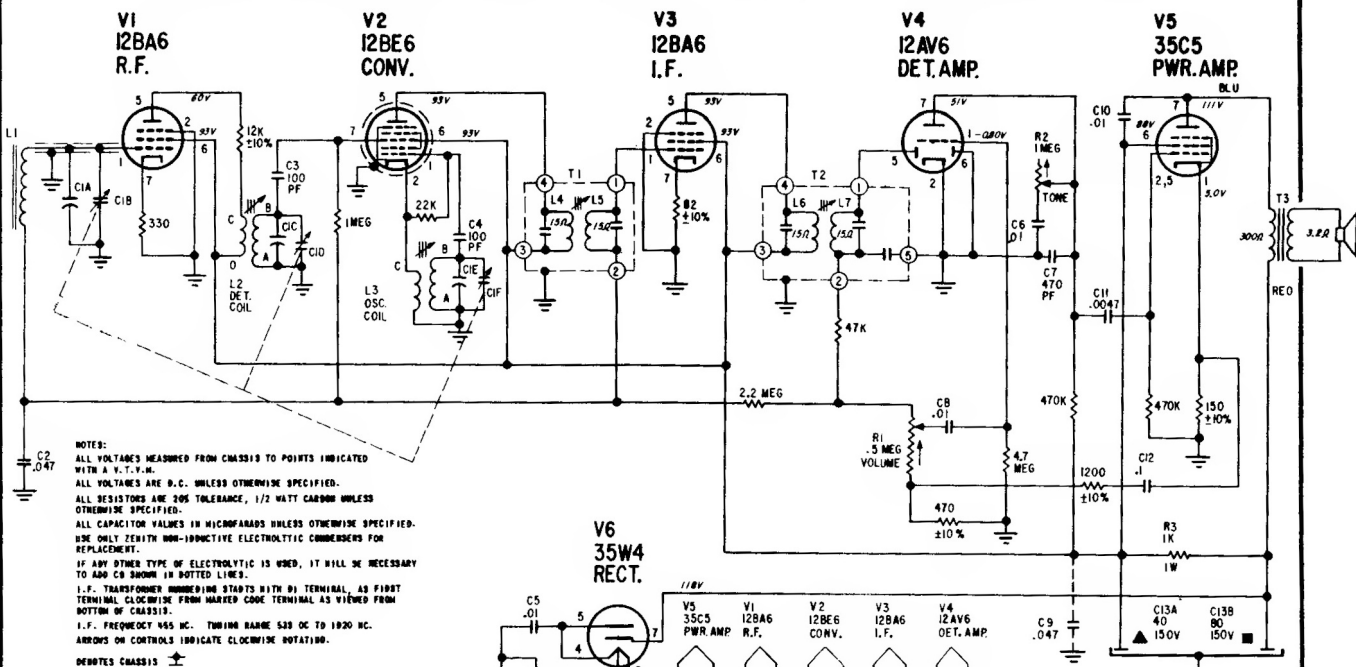

ALIGNMENT PROCEDURE

Operation	Connect Oscillator To	Dummy Antenna	Input Sig. Frequency	Set Dial At	Trimmers	Purpose
1	Converter Grid	.5 Mfd.	455 Kc.	600 Kc	L4, L5, L6, L7	For I.F. Alignment.
2	One Turn Loop Coupled	—	1600 Kc.	1600 Kc.	C1F	Set Oscillator to Dial Scale
3	Loosely to Wave Magnet	—	1400 Kc.	1400 Kc.	C1D, C1B	Align Detector and Antenna Stage