


ZENITH RADIO CORPORATION CHASSIS SR01

MODELS R511R, R511W, R511F & R511V

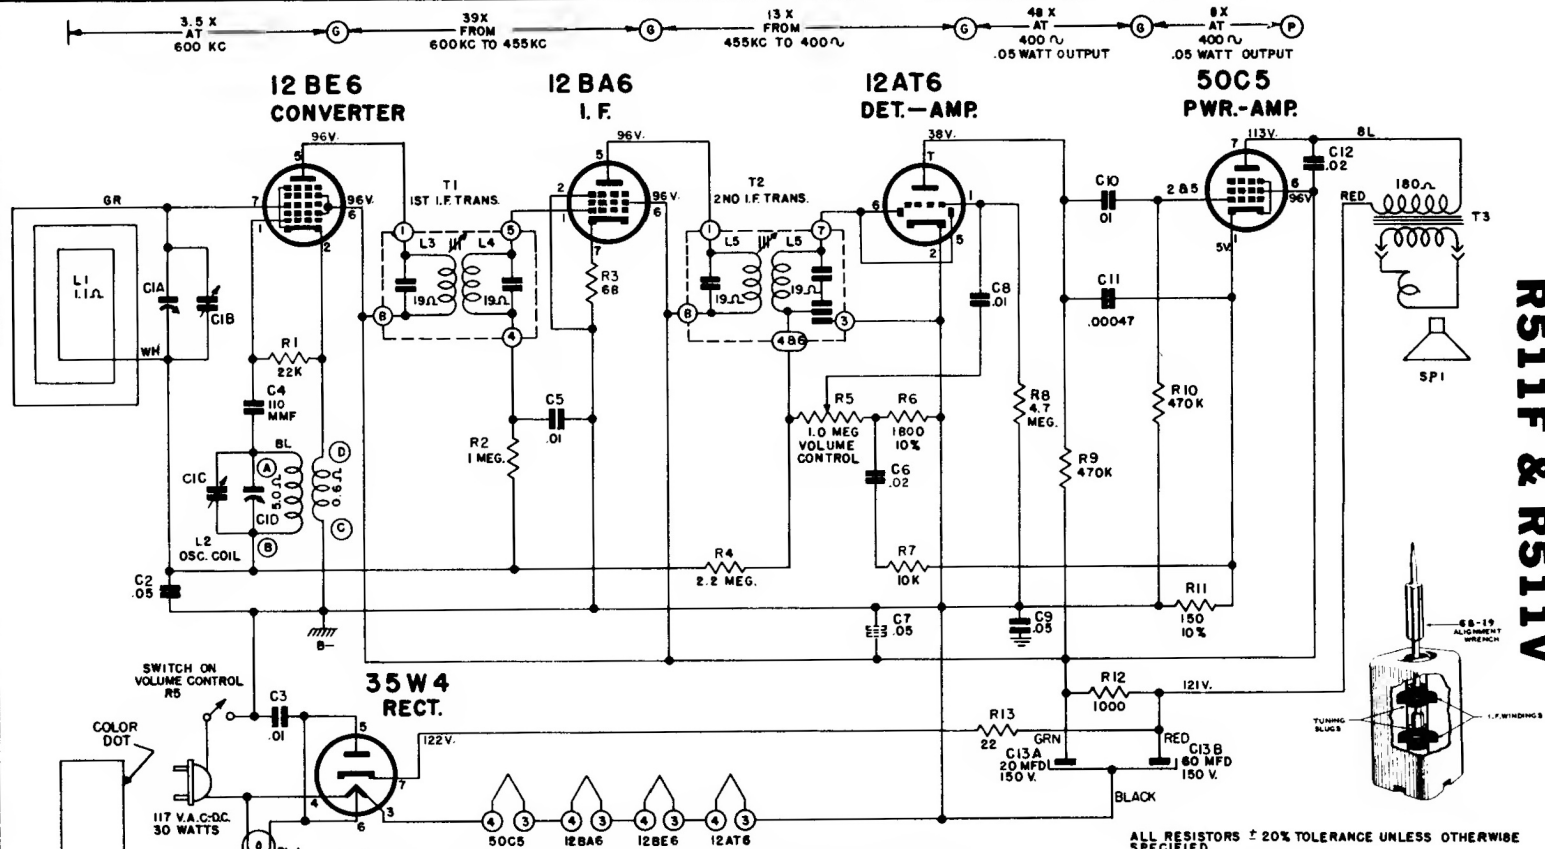

ALIGNMENT PROCEDURE

OPERATION	CONNECT OSCILLATOR TO	DUMMY ANTENNA	INPUT SIG. FREQUENCY	SET DIAL AT	TRIMMERS	PURPOSE
1	Converter Grid	.5 Mfd.	455 Kc.	600 Kc.	L3, L4, L5, L6	Align I.F. for maximum output
2	Gne Turn Loop Coupled Loosely to Wave Magnet	---	1600 Kc.	1600 Kc.	C1C	Set Oscillator to Dial Scale.
3		---	1400 Kc.	1400 Kc.	C1B	Align Antenna Stage

